

Date: Monday, 2/11/2008 11:36:53 AM
 User: Eric Charbonneau

Q Metro

Process Sheet

Customer : CU-DAR001 Dart Helicopters Services	Drawing Name : BK117 SKIDTUBE ASSEMBLY
Job Number : 32910 -1	
Estimate Number : 12898	
P.O. Number :	Part Number : D117762041
This Issue : 2/11/2008 S.O. No. :	Drawing Number : D3582 REV <i>UR 1A</i>
Prsht Rev. : NC	Project Number : LG0005
First Issue : 6/14/2007 Type : LANDING GEAR	Drawing Revision : <i>UR 1A</i> 01.02.10
Previous Run :	Material :
Written By :	Due Date : 6/22/2007 Qty: 1 Um: Each
Checked & Approved By :	
Comment : Est Rev:A 07.06.11 New Issue EC	

USED FOR
 D117-762-041
 B33139

Additional Product

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

1.0	DC	DOCUMENT CONTROL
-----	----	------------------



Comment: DOCUMENT CONTROL

Photocopy bluefile & type labels per PPP D117-762-041 CHG001

2.0	D2962150P	3.540 Outer Tube, Extrut
-----	-----------	--------------------------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 D2962-150 Extrusion *B28672*

DP

08.02.01

3.0	LANDING GEAR 1	LANDING GEAR RESOURCE 1
-----	----------------	-------------------------



Comment: LANDING GEAR RESOURCE 1

1-Determine square end of tube and deburr

2-Drill #30 pilot holes using DT8678. Do not open holes.

3- Deburr holes.

DP

08.02.01

4.0	BENDING	BENDING MACHINE
-----	---------	-----------------



Comment: BENDING MACHINE

Bend tube as per program *D3582* on CNC Bender and Dwg D3582. Use 5/16" locator pin on buggy "A".

DP

08.02.01

Date: Monday, 2/11/2008 11:36:54 AM
User: Eric Charbonneau

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: BK117 SKIDTUBE ASSEMBLY

Job Number: 32910

Part Number: D117762041

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

5.0	LANDING GEAR 1	LANDING GEAR RESOURCE 1
-----	----------------	-------------------------



Comment: LANDING GEAR RESOURCE 1

- 1-Cut Fwd end of the tube using DT8185
- 2-Cut Aft end at VC using DT8185
- 3-Deburr ends
- 4-Drill Aft Cap holes using DT8678 ***DO NOT OPEN AFT CAP HOLE***
- 5-Locate DT & Drill Ground wire hole on top of Tube.
- 6-Install 3/16 cleco in Ground wire hole ,then drill all X-Bolt holes using 3/16" drill.
- 7-Drill pilot holes for wearplates using DT
- 8-Open wearplate holes and ground wire holes to Ø19/64" (0.297") as per Dwg D3582.
- 9-Open Aft Cap holes using .209" drill.
- 10-Deburr holes.

DP 08.02.04

6.0	D2964	Cap
-----	-------	-----



Comment: Qty.: 1.0000 Each(s)/Unit Total : 2.0000 Each(s)

Cap

Batch: B14101

7.0	LANDING GEAR 1	LANDING GEAR RESOURCE 1
-----	----------------	-------------------------



Comment: LANDING GEAR RESOURCE 1

1-Weld fwd cap D2964 per dwg D3582 and QSI 004

A/R AL ROD Batch: M104305/M102421/M104221

BE 08.02.04

2-Grind flush

Date: Monday, 2/11/2008 11:36:54 AM
User: Eric Charbonneau

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: BK117 SKIDTUBE ASSEMBLY

Job Number: 32910

Part Number: D117762041

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

8.0	QC9	VISUAL WELDING INSPECTION
-----	-----	---------------------------



Comment: VISUAL WELDING INSPECTION

AA 08.02.05

9.0	QC5	INSPECT WORK TO CURRENT STEP
-----	-----	------------------------------



Comment: INSPECT WORK TO CURRENT STEP

AA 08.02.05

10.0	HAND FINISHING1	HAND FINISHING RESOURCE #1
------	-----------------	----------------------------



Comment: HAND FINISHING RESOURCE #1
Chemical Conversion Coat as per QSI 005 4.1

DP 08.02.05

11.0	QC3	INSPECT POWDER COAT/CHEMICAL CONVERSION
------	-----	---



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

PH 08.02.05

12.0	D35841	WEB
------	--------	-----



Comment: Qty.: 1.0000 Each(s)/Unit Total: 2.0000 Each(s)
WEB BATCH: B32911

DP 08.02.05

13.0	LANDING GEAR 1	LANDING GEAR RESOURCE 1
------	----------------	-------------------------



Comment: LANDING GEAR RESOURCE 1
1-Open X-Bolt holes to .750"(4Places) as per Dwg D3582, section B-B
2-Counter Sink X-BOLT holes as per Dwg D3582
3-Deburr and blow out chips from inside of tube.

4-Bond web as per Dwg D3582 & QSI 015
A/R 241 Sike Flex Batch: M103561 / M104732 ~~M104732~~
Exp Date: 7-10-1 / 8-1-1

5-Weld x-bolt spacers as per Dwg D3582.
A/R AL ROD Batch: M104305 *BE* 08.02.03
M106330

6-Grind welds flush

DP 08.02.03

Date: Monday, 2/11/2008 11:36:54 AM
User: Eric Charbonneau

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: BK117 SKIDTUBE ASSEMBLY

Job Number: 32910

Part Number: D117762041

Job Number:



Seq. #: Machine Or Operation: Description :

Tools: E

14.0

D2971

Cross Bolt Spacer



Comment: Qty.: 1.0000 Each(s)/Unit Total : 2.0000 Each(s)

Cross Bolt Spacer

batch: B33221

15.0

D36621

SPACER



Comment: Qty.: 3.0000 Each(s)/Unit Total : 6.0000 Each(s)

SPACER

batch: B37189

16.0

D36623

SPACER



Comment: Qty.: 1.0000 Each(s)/Unit Total : 2.0000 Each(s)

SPACER

batch: B37190

17.0

D2973

Cross Bolt Spacer



Comment: Qty.: 2.0000 Each(s)/Unit Total : 4.0000 Each(s)

Cross Bolt Spacer

Batch: B14636

18.0

QC9

VISUAL WELDING INSPECTION



Comment: VISUAL WELDING INSPECTION

PD 08.02.07

19.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

07.02.12 08.02.08

20.0

POWDER COATING

POWDER COATING



M106379



(1X)

Comment: POWDER COATING

Powder Coat White Gloss (Ref: 4.3.5.1) as per QSI 005 4.3

M-L 08/02/12

Date: Monday, 2/11/2008 11:36:54 AM
User: Eric Charbonneau

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: BK117 SKIDTUBE ASSEMBLY

Job Number: 32910

Part Number: D117762041

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

21.0	QC3	INSPECT POWDER COAT/CHEMICAL CONVERSION
------	-----	---



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

RA 08.12.12

22.0	ALS71032130	Insert
------	-------------	--------



*NOT REQ'D ^{RA}
DUPLICATE OF STEP 24*



Comment: Qty.: 38.0000 Each(s)/Unit Total : 76.0000 Each(s)

Insert

Batch: M6989

23.0	ALS4428165	Inserts
------	------------	---------



Comment: Qty.: 2.0000 Each(s)/Unit Total : 4.0000 Each(s)

Inserts (or ALS7-428-165)

batch: M6989

24.0	ALS41032130	Insert
------	-------------	--------



Comment: Qty.: 38.0000 Each(s)/Unit Total : 76.0000 Each(s)

Insert

BATCH : M103495

25.0	HAND FINISHING1	HAND FINISHING RESOURCE #1
------	-----------------	----------------------------



Comment: HAND FINISHING RESOURCE #1

Install Wearplate & Ground Wire inserts as per Dwg D3582.

26.0	QC5	INSPECT WORK TO CURRENT STEP
------	-----	------------------------------



Comment: INSPECT WORK TO CURRENT STEP

Inspect Inserts

RA 08.12.12 08.12.03

27.0	D2965	Cap
------	-------	-----



Comment: Qty.: 1.0000 Each(s)/Unit Total : 2.0000 Each(s)

Cap

Batch: B36033

Date: Monday, 2/11/2008 11:36:54 AM
User: Eric Charbonneau

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: BK117 SKIDTUBE ASSEMBLY

Job Number: 32910

Part Number: D117762041

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

28.0	D35083	WEARPLATE
------	--------	-----------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 2.0000 Each(s)
WEARPLATE
Batch: B33020

29.0	D35089	WEARPLATE
------	--------	-----------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 2.0000 Each(s)
WEARPLATE
Batch: B33013

30.0	D350811	WEARPLATE
------	---------	-----------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 2.0000 Each(s)
WEARPLATE
Batch: B33011

31.0	D350813	WEARPLATE
------	---------	-----------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 2.0000 Each(s)
WEARPLATE
Batch: ~~B33012~~ B336416

32.0	D35583	GASKET
------	--------	--------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 2.0000 Each(s)
GASKET
Batch: B B33021

33.0	D35589	GASKET
------	--------	--------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 2.0000 Each(s)
GASKET
Batch: B33016

34.0	D355811	GASKET
------	---------	--------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 2.0000 Each(s)
GASKET
Batch: B33014

Date: Monday, 2/11/2008 11:36:54 AM
User: Eric Charbonneau

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: BK117 SKIDTUBE ASSEMBLY

Job Number: 32910

Part Number: D117762041

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

35.0	D355813	GASKET
------	---------	--------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 2.0000 Each(s)
GASKET
Batch: B33015

36.0	D3492049	PLUG ASSEMBLY
------	----------	---------------



Comment: Qty.: 2.0000 Each(s)/Unit Total : 4.0000 Each(s)
PLUG ASSEMBLY
batch: B37288

37.0	D3492051	PLUG ASSEMBLY
------	----------	---------------



Comment: Qty.: 2.0000 Each(s)/Unit Total : 4.0000 Each(s)
PLUG ASSEMBLY
batch: B37289

38.0	D3492053	PLUG ASSEMBLY
------	----------	---------------



Comment: Qty.: 6.0000 Each(s)/Unit Total : 12.0000 Each(s)
PLUG ASSEMBLY
batch: B37290 B37474

39.0	AN3C4A	BOLT
------	--------	------



Comment: Qty.: ~~200~~ 60.0000 Each(s)/Unit Total : 60.0000 Each(s)
BOLT
Batch: M103641

40.0	AN3C5A <u>AN3-5A</u>	Bolt
------	----------------------	------



Comment: Qty.: 2.0000 Each(s)/Unit Total : 4.0000 Each(s)
Bolt
Batch: M104118 M100138

41.0	AN960C10L <u>AN960C10L</u>	washer
------	----------------------------	--------



Comment: Qty.: ~~20~~ 64.0000 Each(s)/Unit Total : 64.0000 Each(s)
washer
Batch: M102473

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: BK117 SKIDTUBE ASSEMBLY

Job Number: 32910

Part Number: D117762041

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

42.0	AN44A	Bolt
------	-------	------



Comment: Qty.: 2.0000 Each(s)/Unit Total : 4.0000 Each(s)
Bolt
batch: M106918

43.0	AN960JD416L	Washer
------	-------------	--------



Comment: Qty.: 2.0000 Each(s)/Unit Total : 4.0000 Each(s)
Washer
batch: M106785

44.0	HAND FINISHING1	HAND FINISHING RESOURCE #1
------	-----------------	----------------------------



Comment: HAND FINISHING RESOURCE #1

1-Inspect for Foreign objects

2-Install Aft cap as per Dwg D3582, Detail "C"

A/R 241 Sika Flex Batch: M105585
Exp Date: 07-08

3-Install Wearplates as per Dwg D3582 ,

Note: Install Bolt and washer on Ground Wire inserts on top of tube see section D-D of dwg D3582

*****Do not install bolts where indicated on Dwg(Note #6)*****

A/R 241 Sika Flex Batch: M105585
Exp Date: 07-08

4- Wing Walk as per Dwg D3043 and QSI 005 4.4

45.0	QC5	INSPECT WORK TO CURRENT STEP
------	-----	------------------------------



Comment: INSPECT WORK TO CURRENT STEP

08-02-09

46.0	PACKAGING 1	PACKAGING RESOURCE #1
------	-------------	-----------------------



Comment: PACKAGING RESOURCE #1

Identify and pack for shipping as per PPP D117-762-041

Location: _____

PPP Rev: _____

Date: Monday, 2/11/2008 11:36:54 AM
User: Eric Charbonneau

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: BK117 SKIDTUBE ASSEMBLY

Job Number: 32910

Part Number: D117762041

Job Number:



Seq. #:

Machine Or Operation:

Description :

47.0

QC21

FINAL INSPECTION/W/O RELEASE



Comment: FINAL INSPECTION/W/O RELEASE

208/04/07

Job Completion



N/A FOR
CONFORMITY
08-02-12

D2964 CAP
(GRIND FLUSH)

DETAIL C
SCALE 1:10



D2971 SPACER

AFTER FINISH
INSTALL,
D3492-049
PLUG ASSEMBLY
(2 PLACES)

SECTION D-D
SCALE 3:10

AFTER FINISH
INSTALL,
D3492-051
PLUG ASSEMBLY
(2 PLACES)

SECTION E-E
SCALE 3:10

D3662-3 SPACER

NO BOLTS AT
THESE LOCATIONS

D3582-041 ASSEMBLY DETAIL

NO BOLTS AT
THESE LOCATIONS

BLACK ANTI-SKID

BLACK ANTI-SKID (TYP)

D3582-041 BLACK ANTI-SKID DETAIL

SECTION D-D NOTES

AFTER BENDING AND DRILLING ASSEMBLY
PERFORM THE FOLLOWING:

1. CHAMFER HOLE 0.030 x 45°
2. INSERT D2971 SPACER
3. WELD INTO PLACE AND GRIND FLUSH
4. PASS Ø0.750 DRILL TO REMOVE SPILL OVER
5. AFTER FINISH, INSTALL D3492-049 PLUG ASSEMBLY (2 PLACES)

SECTION E-E NOTES

AFTER BENDING AND DRILLING ASSEMBLY
PERFORM THE FOLLOWING:

1. CHAMFER HOLE 0.030 x 45°
2. INSERT D3662-3 SPACER
3. WELD INTO PLACE AND GRIND FLUSH
4. PASS Ø0.672 DRILL TO REMOVE SPILL OVER
5. AFTER FINISH, INSTALL D3492-051 PLUG ASSEMBLY (2 PLACES)

D2973 SPACER
(2 PLACES)

SECTION F-F
SCALE 3:10

SECTION F-F NOTES

AFTER BENDING AND DRILLING ASSEMBLY
PERFORM THE FOLLOWING:

1. CHAMFER HOLE 0.030 x 45°
2. INSERT D2973 SPACER (2 PLACES)
3. WELD INTO PLACE AND GRIND FLUSH
4. PASS Ø0.625 DRILL TO REMOVE SPILL OVER

D3584-1 WEB (REF)

D3662-1 SPACER
(3 PLACES)

AFTER FINISH, INSTALL
AELS-1032-130
INSERT (36 PLACES)

AN3C4A BOLT (1)
AN960C10L WASHER (1)
(28 PLACES)

SECTION G-G
SCALE 3:10


AFTER FINISH, INSTALL
ALS7-428-165 INSERT (1)
AN4-4A BOLT (1)
AN960JD416L WASHER (1)
(2 PLACES)

AFTER FINISH
INSTALL,
D3492-053
PLUG ASSEMBLY
(6 PLACES)

SECTION G-G NOTES

AFTER BENDING AND DRILLING ASSEMBLY
PERFORM THE FOLLOWING:

1. CHAMFER HOLE 0.030 x 45°
2. INSERT D3662-1 SPACER (3 PLACES)
3. WELD INTO PLACE AND GRIND FLUSH
4. PASS Ø0.515 DRILL TO REMOVE SPILL OVER
5. AFTER FINISH, INSTALL D3492-053 PLUG ASSEMBLY (6 PLACES)

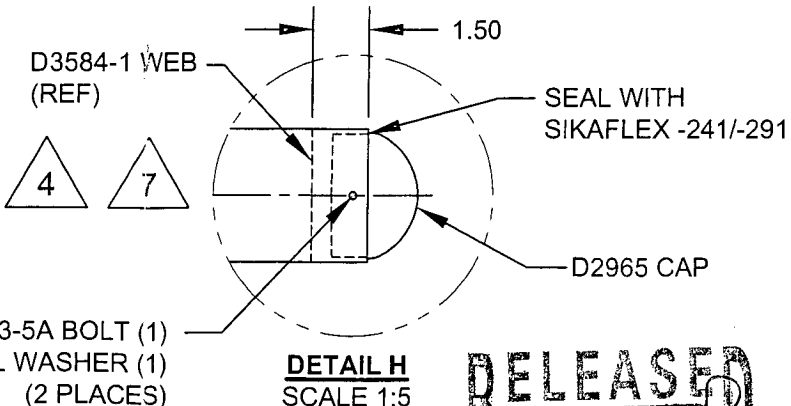

DETAIL H
SCALE 1:5

RELEASED
07.11.22


DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	PH	PORT HADLOCK, WA	
CHECKED	h	DRAWING NO.	REV. A
MFG. APPR.	MA	D3582	SHEET 2 OF 2
APPROVED	MP	TITLE	SCALE
DE APPR.	JE	BK 117 SKIDTUBE ASSEMBLY	1:20
DATE	07.06.08	COPYRIGHT © 2007 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

PARTS LIST FOR D3582-041 SKIDTUBE ASSEMBLY


Qty	Part Number	Description
X	D3582-041	SKIDTUBE ASSEMBLY
1	D2962-150	EXTRUSION
1	D2964	CAP
1	D2965	CAP
1	D2971	CROSS BOLT SPACER
2	D2973	CROSS BOLT SPACER
2	D3492-049	PLUG ASSEMBLY
2	D3492-051	PLUG ASSEMBLY
6	D3492-053	PLUG ASSEMBLY
1	D3508-3	WEARPLATE
1	D3508-9	WEARPLATE
1	D3508-11	WEARPLATE
1	D3508-13	WEARPLATE
1	D3558-3	GASKET
1	D3558-9	GASKET
1	D3558-11	GASKET
1	D3558-13	GASKET
1	D3584-1	WEB
3	D3662-1	CROSS BOLT SPACER
1	D3662-3	CROSS BOLT SPACER
36	AELS-1032-130	INSERT
2	ALS7-428-165	INSERT
28	AN3C4A	BOLT
2	AN3-5A	BOLT
2	AN4-4A	BOLT
28	AN960C10L	WASHER
2	AN960JD10L	WASHER
2	AN960JD416L	WASHER

GENERAL NOTES:


- ALL DIMENSIONS ARE IN INCHES
- TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED
- WELDING TO BE DONE PER DART QSI 004.
- INSERT D3584-1 WEB TO LOCATION SHOWN OFF AFT END OF SKIDTUBE AND BOND WEB INTO OUTER TUBE WITH NON-STRUCTURAL SIKAFLEX-241/-291 ADHESIVE PER DART QSI 015 AFTER BENDING.
- USE DART DRILL TEMPLATE DT8900 TO LOCATE AND DRILL $\varnothing 0.297$ HOLES (36 PLACES) FOR WEARSHOE INSERTS. INSTALL AELS-1032-130 PER SECTION G-G (36 PLACES) AFTER FINISH. SEAL WEARPLATE BOLTS WITH SIKAFLEX-241/-291.
- DO NOT INSTALL AN3C4A BOLTS AND AN960C10L WASHERS IN INDICATED LOCATIONS.
- FINISH:
 - CHEMICAL CONVERSION COAT PER DART QSI 005 4.1 PRIOR TO INSERTING D3584-1 WEB.
 - POWDER COAT ASSEMBLY GLOSS WHITE (REF 4.3.5.1) PER DART QSI 005 4.3.
 - ANTI-SKID PAINT AS INDICATED TO 1.00 ABOVE CENTER LINE PER DART QSI 005 4.4

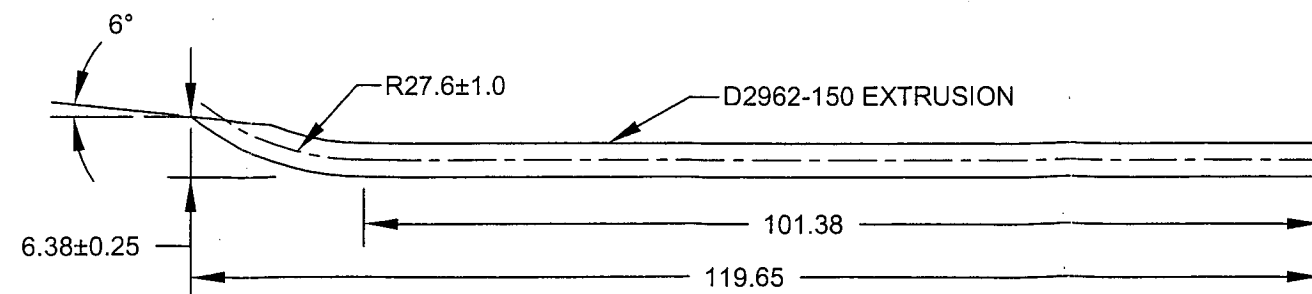


D3582-1 BENDING AND CUTTING DETAIL

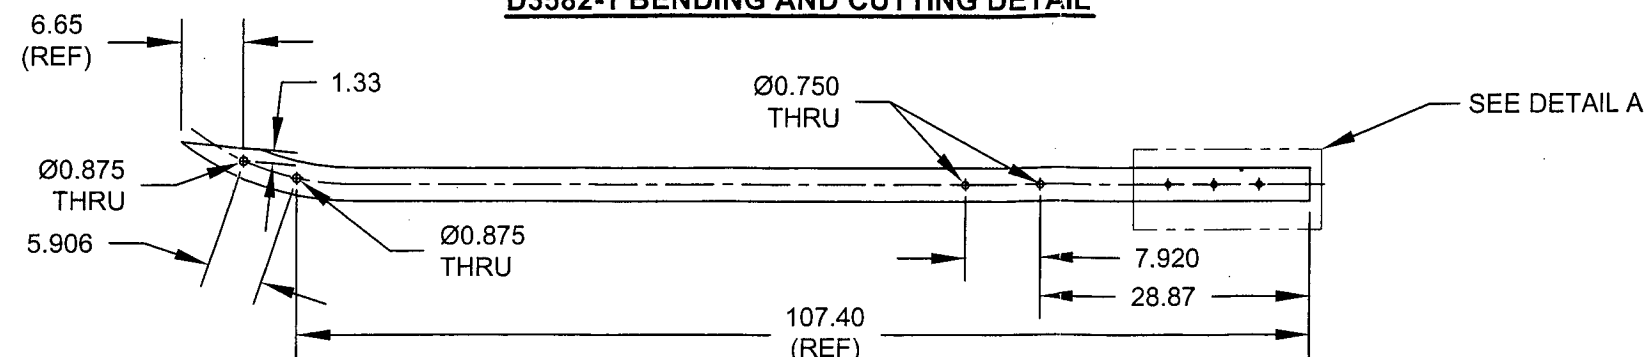

D3582-1 DRILLING DETAIL

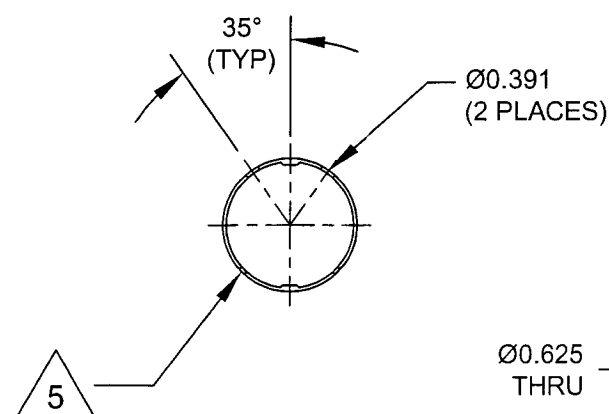

SECTION B-B
SCALE 1:5

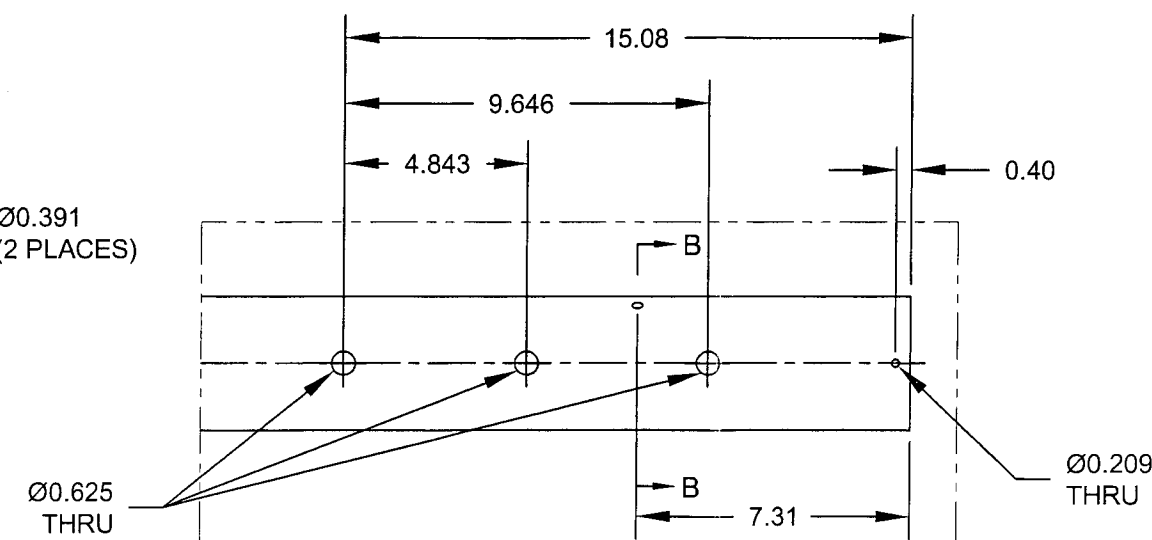

DETAIL A
SCALE 1:5

RELEASED
07.11.22

A	NEW ISSUE	PH	07.06.08
REV.	DESCRIPTION	BY	DATE
DESIGN	PH	DART AEROSPACE USA, INC PORT HADLOCK, WA	
DRAWN	PH		
CHECKED	PH	DRAWING NO.	REV. A
MFG. APPR.	PH	D3582	SHEET 1 OF 2
APPROVED	PH	TITLE	SCALE
DE APPR.	PH	BK 117 SKIDTUBE ASSEMBLY	1:20
DATE	07.06.08	COPYRIGHT © 2007 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	



Date:
User:

Process Sheet

Customer
Job Number
Estimate Number
P.O. Number
This Issue
Prsht Rev.
First Issue
Previous Run
Written By
Checked & Approved
Comment

Date,

Please file this in
the D117-762-011 file

Thanks, Peter

エアロファシリティ株式会社

Tel 03-5574-7655

Drawing Name : BK 117 SKIDTUBE

Part Number : ENGINEERING

Drawing Number : BK 117 SKIDTUBE

Project Number : LG0005

Drawing Revision : N/A

Material :

Due Date : 10/4/2006

Qty: 1 Um: Each

Job Number:



Seq. #: Machine Or Operation:

Description :

1.0 ENGINEERING 1

ENGINEERING RESOURCE #1



Comment: ENGINEERING RESOURCE #1

Project Evaluation:

Involved: Marketing, Sales, Eng & Management

D117-762-041 B32910 and D117-762-011

B33139

080118

Comments:

RE-WORK

D2971 B33221 2Pc

D3662-3 B37190 2Pc

D3662-1 B37189 6Pc

BE 08/02/06

ALuminum ROD m106330

- Inspect QC #9 PD 08-02-06
welding

- Inspect QC #5
work to current step 08/02/06

Process Sheet

Customer: CC-DAR01 Dart Aerospace Ltd.

Drawing Name: BK 117 SKIDTUBE

Job Number: 00083

Part Number: ENGINEERING

Job Number:



Seq. #:

Machine Or Operation:

Description :

RE-FINISH

QC3 PAINT
INSTALL AELS-1032-130 INSERT (36) B QTY(2)
ALS2-423-165 INSERT (2) B M679 6989 (4)

INSTALL WEARPLATES AND GASKETS

D3507-3

D3558-3

CAP

D3965 B36033

D3507-13 B36416

USING AN324A BOLTS
AN960C10L WASHER

SEE
ATTACHED

INSTALL AN4-4A M106918 (SECTION G-G) 12 PLACES
AN9605D416L M106785

INSTALL D3492-049 PLUGS (2) B37288
D3492-051 " (2) B37289
D3492-053 " (6) B37290

TURN OVER

2.0

ENGINEERING 1

ENGINEERING RESOURCE #1



Comment: ENGINEERING RESOURCE #1

Input Review:

Involved: Sales, Eng & Manufacturing Eng

Comments:

- QC # 5 inspect final work
- QC # 6 inspect work

08.02.12

D3512-1 B 36180 QTY (2)

3.0

MFG ENGINEERING

MFG ENGINEERING



Comment: MFG ENGINEERING

Create Initial Estimate :

Involved: Manegment & Mfg Engineering

N/A 08.02.14

• INSTALL 02965 CAP B36033

AM3-SH BOLT
~~AN96050101~~ WASHER (2)
AN3-SH BOLT M10011?
AN96050101 WASHER M104735

• WING WALK PER D3582

02965 CAP

AN96050101

AN3-SH BOLT

AN96050101

02965 CAP

02965 CAP

Process Sheet

Drawing Name: BK 117 SKIDTUBE

Part Number: ENGINEERING

Copyright © 2006 by John Wiley & Sons, Inc.

Description :

—
—
—
—
—
—
—
—
—
—
—
—

1. The first step in the process is to identify the problem. This involves gathering information about the situation and understanding the needs of the stakeholders involved.

2. Once the problem is identified, the next step is to develop a plan. This involves setting goals, identifying resources, and determining the steps that need to be taken to address the problem.

3. The third step is to implement the plan. This involves putting the plan into action and monitoring progress to ensure that the goals are being met.

4. Finally, the fourth step is to evaluate the results. This involves assessing the effectiveness of the plan and making adjustments as needed to improve the outcome.

[illegible]

—
—
—
—
—
—
—
—
—
—
—

N/A ~~24~~ 03.02.14

1
 2
 3
 4
 5
 6
 7
 8
 9
 10
 11
 12
 13
 14
 15
 16
 17
 18
 19
 20
 21
 22
 23
 24
 25
 26
 27
 28
 29
 30
 31
 32
 33
 34
 35
 36
 37
 38
 39
 40
 41
 42
 43
 44
 45
 46
 47
 48
 49
 50
 51
 52
 53
 54
 55
 56
 57
 58
 59
 60
 61
 62
 63
 64
 65
 66
 67
 68
 69
 70
 71
 72
 73
 74
 75
 76
 77
 78
 79
 80
 81
 82
 83
 84
 85
 86
 87
 88
 89
 90
 91
 92
 93
 94
 95
 96
 97
 98
 99
 100
 101
 102
 103
 104
 105
 106
 107
 108
 109
 110
 111
 112
 113
 114
 115
 116
 117
 118
 119
 120
 121
 122
 123
 124
 125
 126
 127
 128
 129
 130
 131
 132
 133
 134
 135
 136
 137
 138
 139
 140
 141
 142
 143
 144
 145
 146
 147
 148
 149
 150
 151
 152
 153
 154
 155
 156
 157
 158
 159
 160
 161
 162
 163
 164
 165
 166
 167
 168
 169
 170
 171
 172
 173
 174
 175
 176
 177
 178
 179
 180
 181
 182
 183
 184
 185
 186
 187
 188
 189
 190
 191
 192
 193
 194
 195
 196
 197
 198
 199
 200
 201
 202
 203
 204
 205
 206
 207
 208
 209
 210
 211
 212
 213
 214
 215
 216
 217
 218
 219
 220
 221
 222
 223
 224
 225
 226
 227
 228
 229
 230
 231
 232
 233
 234
 235
 236
 237
 238
 239
 240
 241
 242
 243
 244
 245
 246
 247
 248
 249
 250
 251
 252
 253
 254
 255
 256
 257
 258
 259
 260
 261
 262
 263
 264
 265
 266
 267
 268
 269
 270
 271
 272
 273
 274
 275
 276
 277
 278
 279
 280
 281
 282
 283
 284
 285
 286
 287
 288
 289
 290
 291
 292
 293
 294
 295
 296
 297
 298
 299
 300
 301
 302
 303
 304
 305
 306
 307
 308
 309
 310
 311
 312
 313
 314
 315
 316
 317
 318
 319
 320
 321
 322
 323
 324
 325
 326
 327
 328
 329
 330
 331
 332
 333
 334
 335
 336
 337
 338
 339
 340
 341
 342
 343
 344
 345
 346
 347
 348
 349
 350
 351
 352
 353
 354
 355
 356
 357
 358
 359
 360
 361
 362
 363
 364
 365
 366
 367
 368
 369
 370
 371
 372
 373
 374
 375
 376
 377
 378
 379
 380
 381
 382
 383
 384
 385
 386
 387
 388
 389
 390
 391
 392
 393
 394
 395
 396
 397
 398
 399
 400
 401
 402
 403
 404
 405
 406
 407
 408
 409
 410
 411
 412
 413
 414
 415
 416
 417
 418
 419
 420
 421
 422
 423
 424
 425
 426
 427
 428
 429
 430
 431
 432
 433
 434
 435
 436
 437
 438
 439
 440
 441
 442
 443
 444
 445
 446
 447
 448
 449
 450
 451
 452
 453
 454
 455
 456
 457
 458
 459
 460
 461
 462
 463
 464
 465
 466
 467
 468
 469
 470
 471
 472
 473
 474
 475
 476
 477
 478
 479
 480
 481
 482
 483
 484
 485
 486
 487
 488
 489
 490
 491
 492
 493
 494
 495
 496
 497
 498
 499
 500
 501
 502
 503
 504
 505
 506
 507
 508
 509
 510
 511
 512
 513
 514
 515
 516
 517
 518
 519
 520
 521
 522
 523
 524
 525

1
2
3
4
5
6
7
8
9
10
11
12
13
14
15
16
17
18
19
20
21
22
23
24
25
26
27
28
29
30
31
32
33
34
35
36
37
38
39
40
41
42
43
44
45
46
47
48
49
50
51
52
53
54
55
56
57
58
59
60
61
62
63
64
65
66
67
68
69
70
71
72
73
74
75
76
77
78
79
80
81
82
83
84
85
86
87
88
89
90
91
92
93
94
95
96
97
98
99
100
101
102
103
104
105
106
107
108
109
110
111
112
113
114
115
116
117
118
119
120
121
122
123
124
125
126
127
128
129
130
131
132
133
134
135
136
137
138
139
140
141
142
143
144
145
146
147
148
149
150
151
152
153
154
155
156
157
158
159
160
161
162
163
164
165
166
167
168
169
170
171
172
173
174
175
176
177
178
179
180
181
182
183
184
185
186
187
188
189
190
191
192
193
194
195
196
197
198
199
200
201
202
203
204
205
206
207
208
209
210
211
212
213
214
215
216
217
218
219
220
221
222
223
224
225
226
227
228
229
230
231
232
233
234
235
236
237
238
239
240
241
242
243
244
245
246
247
248
249
250
251
252
253
254
255
256
257
258
259
260
261
262
263
264
265
266
267
268
269
270
271
272
273
274
275
276
277
278
279
280
281
282
283
284
285
286
287
288
289
290
291
292
293
294
295
296
297
298
299
300
301
302
303
304
305
306
307
308
309
310
311
312
313
314
315
316
317
318
319
320
321
322
323
324
325
326
327
328
329
330
331
332
333
334
335
336
337
338
339
340
341
342
343
344
345
346
347
348
349
350
351
352
353
354
355
356
357
358
359
360
361
362
363
364
365
366
367
368
369
370
371
372
373
374
375
376
377
378
379
380
381
382
383
384
385
386
387
388
389
390
391
392
393
394
395
396
397
398
399
400
401
402
403
404
405
406
407
408
409
410
411
412
413
414
415
416
417
418
419
420
421
422
423
424
425
426
427
428
429
430
431
432
433
434
435
436
437
438
439
440
441
442
443
444
445
446
447
448
449
450
451
452
453
454
455
456
457
458
459
460
461
462
463
464
465
466
467
468
469
470
471
472
473
474
475
476
477
478
479
480
481
482
483
484
485
486
487
488
489
490
491
492
493
494
495
496
497
498
499
500
501
502
503
504
505
506
507
508
509
510
511
512
513
514
515
516
517
518
519
520
521
522
523
524
525
526
527
528
529
530
531
532
533
534
535
536
537
538
539
540
541
542
543
544
545
546
547
548
549
550
551
552
553
554
555
556
557
558
559
560
561
562
563
564
565
566
567
568
569
570
571
572
573
574
575
576
577
578
579
580
581
582
583
584
585
586
587
588
589
590
591
592
593
594
595
596
597
598
599
600
601
602
603
604
605
606
607
608
609
610
611
612
613
614
615
616
617
618
619
620
621
622
623
624
625
626
627
628
629
630
631
632
633
634
635
636
637
638
639
640
641
642
643
644
645
646
647
648
649
650
651
652
653
654
655
656
657
658
659
660
661
662
663
664
665
666
667
668
669
670
671
672
673
674
675
676
677
678
679
680
681
682
683
684
685
686
687
688
689
690
691
692
693
694
695
696
697
698
699
700
701
702
703
704
705
706
707
708
709
710
711
712
713
714
715
716
717
718
719
720
721
722
723
724
725
726
727
728
729
730
731
732
733
734
735
736
737
738
739
740
741
742
743
744
745
746
747
748
749
750
751
752
753
754
755
756
757
758
759
760
761
762
763
764
765
766
767
768
769
770
771
772
773
774
775
776
777
778
779
780
781
782
783
784
785
786
787
788
789
790
791
792
793
794
795
796
797
798
799
800
801
802
803
804
805
806
807
808
809
810
811
812
813
814
815
816
817
818
819
820
821
822
823
824
825
826
827
828
829
830
831
832
833
834
835
836
837
838
839
840
84

[illegible]

1. The first step in the process is to identify the problem or issue that needs to be addressed. This involves gathering information and understanding the context of the problem.


2. Once the problem is identified, the next step is to define the objectives and goals of the project. This helps to clarify what needs to be achieved and provides a clear direction for the team.

3. The third step is to develop a plan or strategy to address the problem. This involves breaking down the problem into smaller, manageable tasks and determining the resources needed to complete each task.







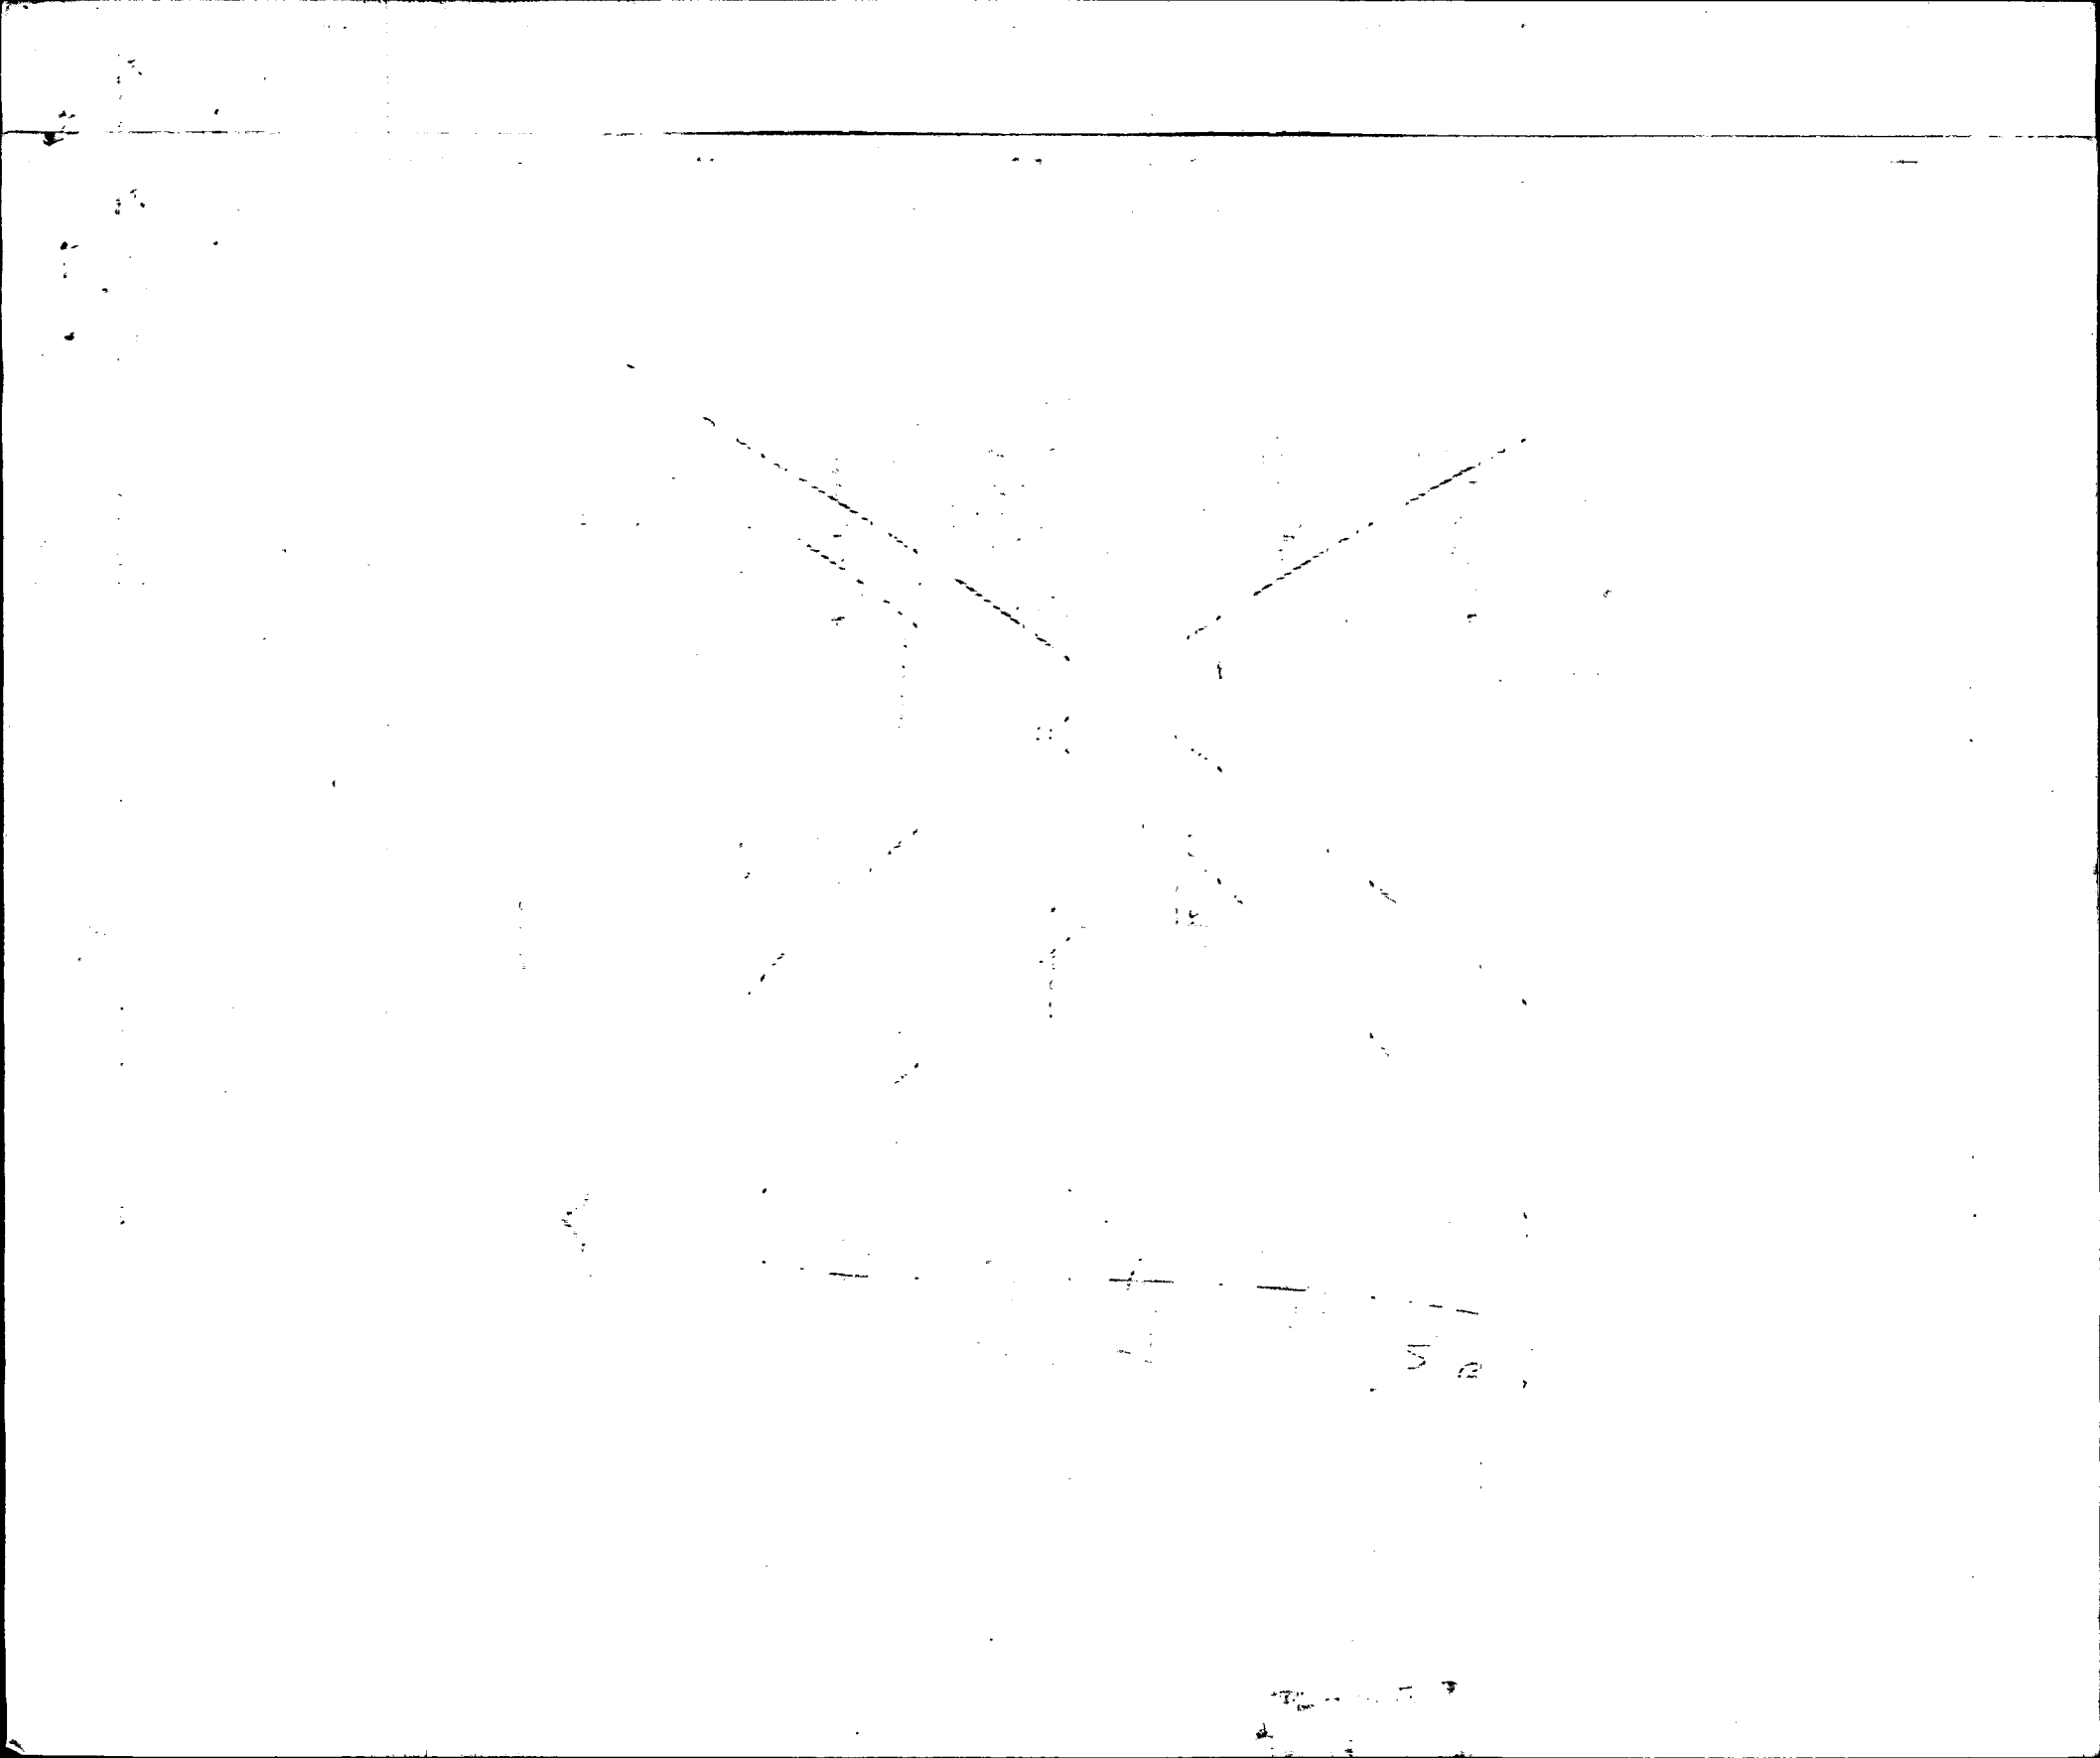






4. The fourth step is to implement the plan. This involves putting the strategy into action and monitoring progress regularly to ensure that the project is on track.

5. The final step is to evaluate the results of the project. This involves comparing the actual outcomes against the objectives and goals to determine the effectiveness of the project.

—



Process Sheet

Customer: CC-DAR01 Dart Aerospace Ltd.		Drawing Name: BK 117 SKIDTUBE	
Job Number: 00083		Part Number: ENGINEERING	
Job Number:			
Seq. #:	Machine Or Operation:	Description :	
10.0	MFG ENGINEERING	MFG ENGINEERING	
			
Comment: MFG ENGINEERING 1-Create NC programs if Applicable 2-Create Tooling if Applicable 3-Link 1st W/O (s) to Project W/O FOR 1ST Production Unit			
11.0	OUTSIDE SERVICE	OUTSIDE SERVICES	
			
Comment: Sub-Contracting OUTSIDE SERVICES(Acuren Group p/o 2524 testing & analysis			
12.0	OUTSIDE SERVICE	OUTSIDE SERVICES	
			
Comment: Sub-Contracting TRADEWIND P/O 2232 PART # 1121-51002 SKID SHOE			
13.0	OUTSIDE SERVICE	OUTSIDE SERVICES	
			
Comment: Sub-Contracting TRADEWIND P/O 2232 PART # 1121-51102 clamping ring			
14.0	SMALL FAB 1	SMALL & MEDIUM FAB RESOURCE 1	
			
Comment: SMALL & MEDIUM FAB RESOURCE 1			
15.0	QC21	FINAL INSPECTION/W/O RELEASE	
			
Comment: FINAL INSPECTION/W/O RELEASE			

N/A 08.02.14
H

72 8/20/14

Job Completion





Parts used on 00083 ~~PH~~ 08.02.12

Part Number	Batch	QTY
D2965	B36033	2 1
D3508-13	B36416	2 1
D3512-1	B36180	4 2
D3492-049	B37288	2
D3492-051	B37289	2 4
D3492-053	B37290	2 7
ALS4-428-165	B6989	2
AN3-5A	M100188	2
AN4-4A	M106918	2
AN960JD416L	M106785	2
AN960JD10L	M104885	2

~~D3508-13~~

D3508-13
D3556-13

D3492-053 were changed to D3492-053 B37474

SKIDTUBE WILL BE LABELED D117-762-011 B33139 ~~PH~~
08.02.12